flow 7PACK 0 — Output Inverter Application — 1200 V / 8 A

General conditions

3phase SPWM		
V_{GEon}	=	15 V
V_{GEoff}	=	-15 V
R_{gon}	=	32 Ω
R_{goff}	=	32 Ω

Figure 1 IGBT

Typical average static loss as a function of output current $P_{loss} = f(I_{out})$

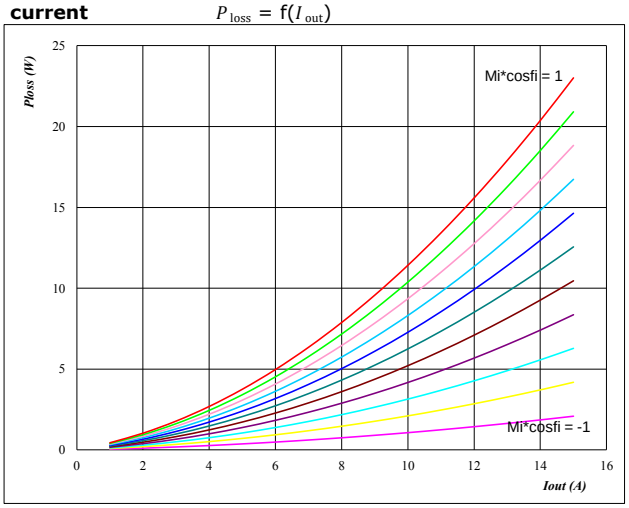

At

T_j = 149 °C

Mi*cosφ from -1 to 1 in steps of 0,2

Figure 2 FWD

Typical average static loss as a function of output current $P_{loss} = f(I_{out})$

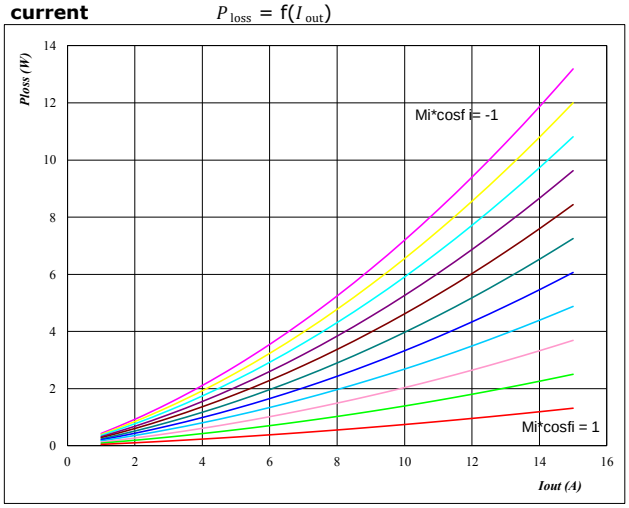

At

T_j = 149 °C

Mi*cosφ from -1 to 1 in steps of 0,2

Figure 3 IGBT

Typical average switching loss as a function of output current $P_{loss} = f(I_{out})$

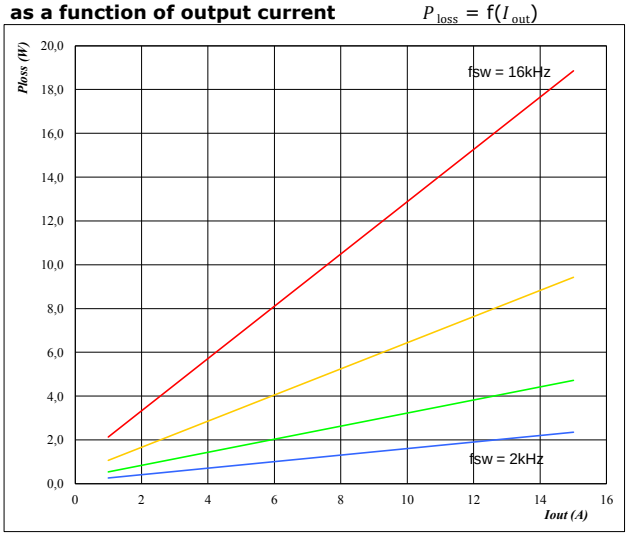

At

T_j = 149 °C

DC link = 600 V

f_{sw} from 2 kHz to 16 kHz in steps of factor 2

Figure 4 FWD

Typical average switching loss as a function of output current $P_{loss} = f(I_{out})$

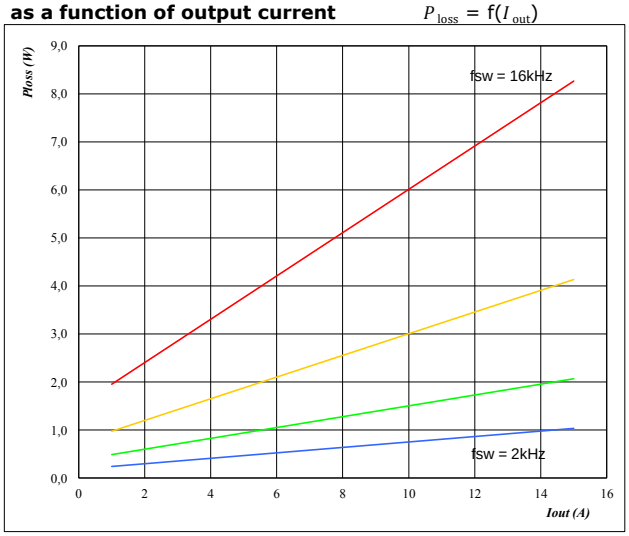

At

T_j = 149 °C

DC link = 600 V

f_{sw} from 2 kHz to 16 kHz in steps of factor 2

Figure 5 Phase

Typical available 50Hz output current as a function Mi*cosφ I_{out} = f(Mi*cos φ)

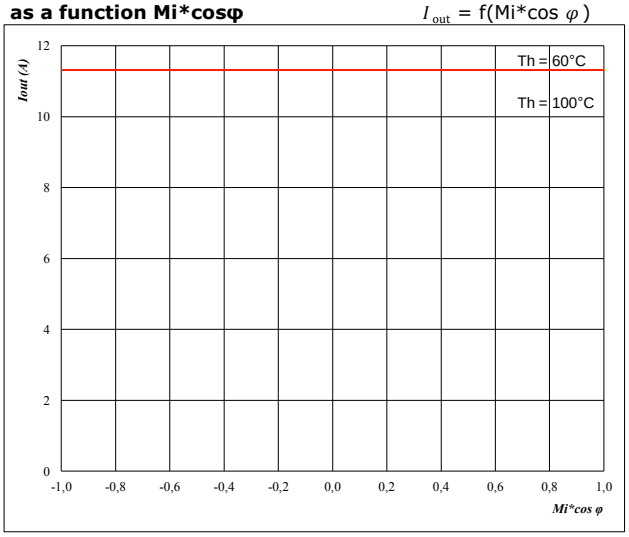

At

T_j =	149	°C
DC link =	600	V
f_{sw} =	4	kHz
T_h from	60 °C to 100 °C in steps of 5 °C	

Figure 6 Phase

Typical available 50Hz output current as a function of switching frequency I_{out} = f(f_{sw})

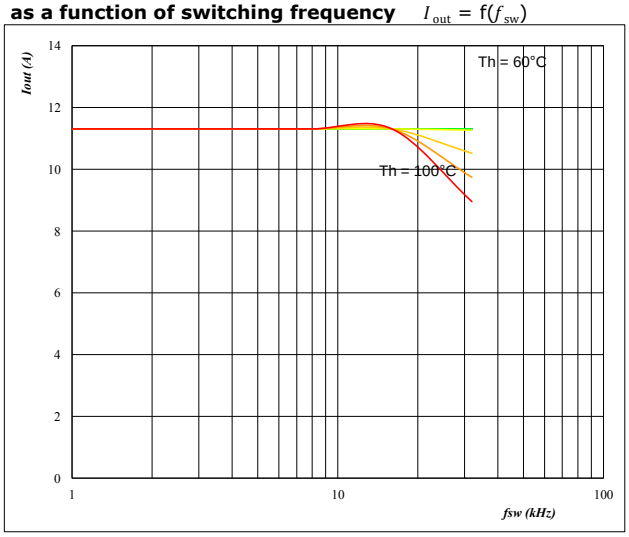

At

T_j =	149	°C
DC link =	600	V
Mi*cos φ =	0,8	
T_h from	60 °C to 100 °C in steps of 5 °C	

Figure 7 Phase

Typical available 50Hz output current as a function of Mi*cos φ and switching frequency I_{out} = f(f_{sw}, Mi*cos φ)

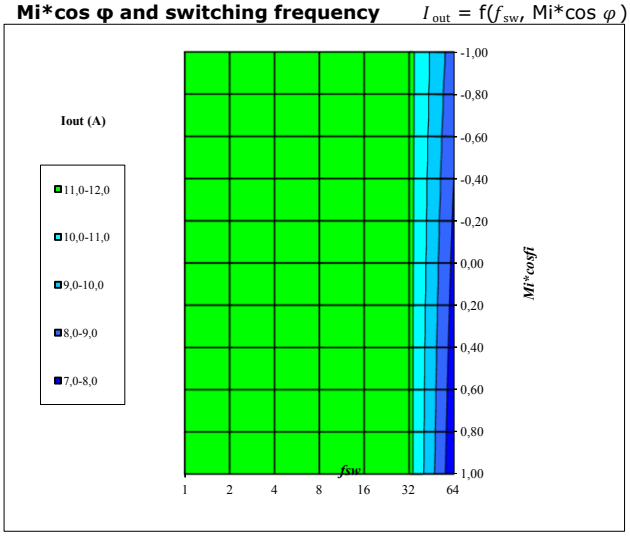

At

T_j =	149	°C
DC link =	600	V
T_h =	80	°C

Figure 8 Phase

Typical available 0Hz output current as a function of switching frequency $I_{outpeak}$ = f(f_{sw})

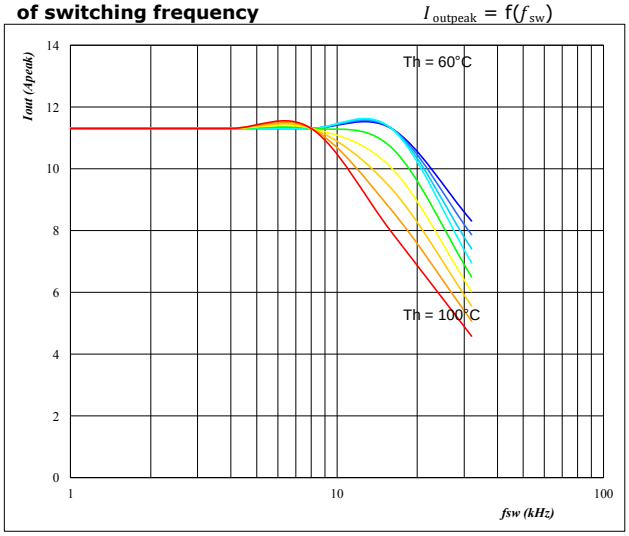

At

T_j =	149	°C
DC link =	600	V
T_h from	60 °C to 100 °C in steps of 5 °C	
Mi =	0	

Figure 9 Inverter

Typical available peak output power as a function of heatsink temperature $P_{out}=f(T_h)$

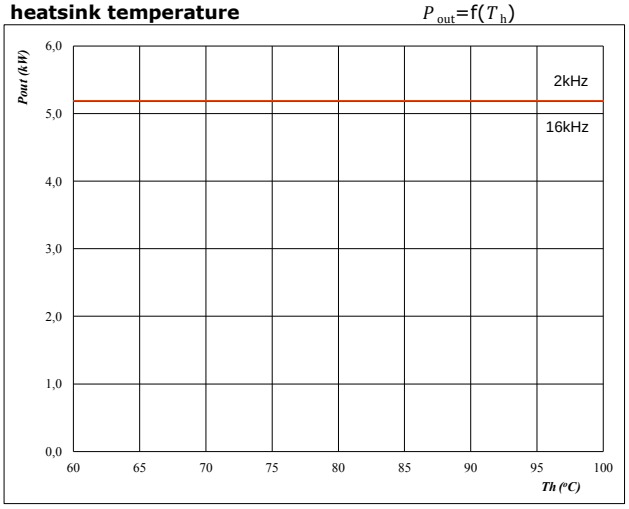

At

T_j =	149	°C
DC link =	600	V
Mi =	1	
cos φ=	0,80	
f_{sw} from	2 kHz to 16 kHz in steps of factor 2	

Figure 10 Inverter

Typical efficiency as a function of output power

efficiency=f(P_{out})

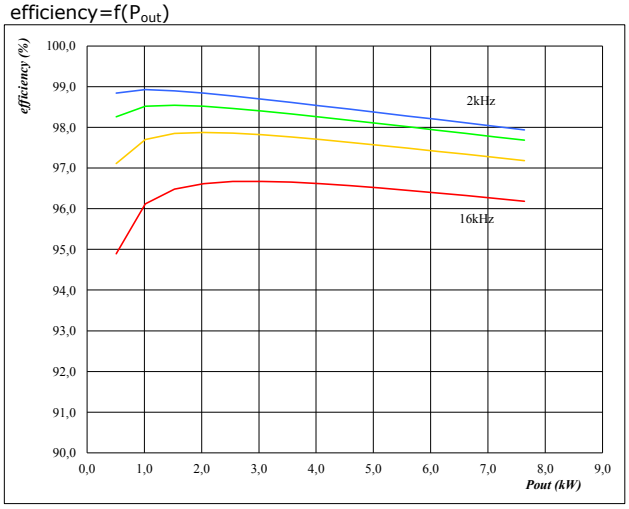

At

T_j =	149	°C
DC link =	600	V
Mi =	1	
cos φ=	0,80	
f_{sw} from	2 kHz to 16 kHz in steps of factor 2	

Figure 11 Inverter

Typical available overload factor as a function of motor power and switching frequency P_{peak} / $P_{nom}=f(P_{nom},fsw)$

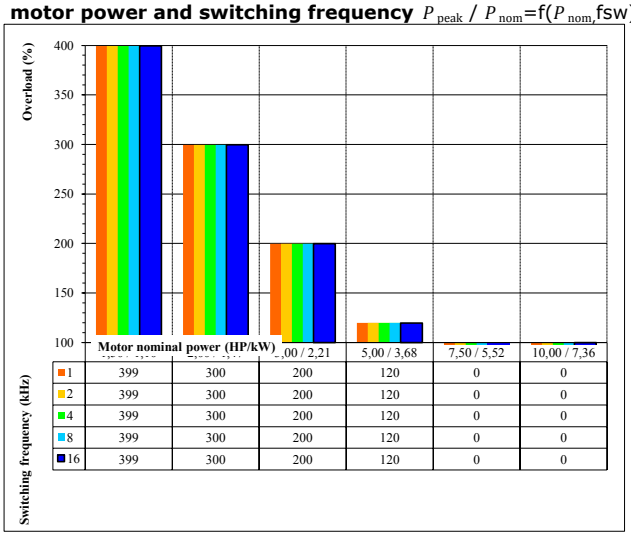

At

T_j =	149	°C
DC link =	600	V
Mi =	1	
cos φ=	0,8	
f_{sw} from	1 kHz to 16kHz in steps of factor 2	
T_h =	80	°C
Motor eff =	0,85	