flow MNPC 12w — mixed voltage NPC Application — 1200 V / 1800 A

General conditions

Half Bridge IGBT		
V_{GEon}	=	15 V
V_{GEoff}	=	-8 V
R_{gon}	=	0,92 Ω *
R_{goff}	=	0,92 Ω *

V_{out}= 230 VAC

* including chip gate resistor

Neutral Point IGBT		
V_{GEon}	=	15 V
V_{GEoff}	=	-8 V
R_{gon}	=	0,66 Ω *
R_{goff}	=	0,66 Ω *

Figure 1. Half Bridge IGBT

Typical average static loss as a function of of output current I_{oRMS}

$P_{loss}=f(I_{out})$ **T1, T4**

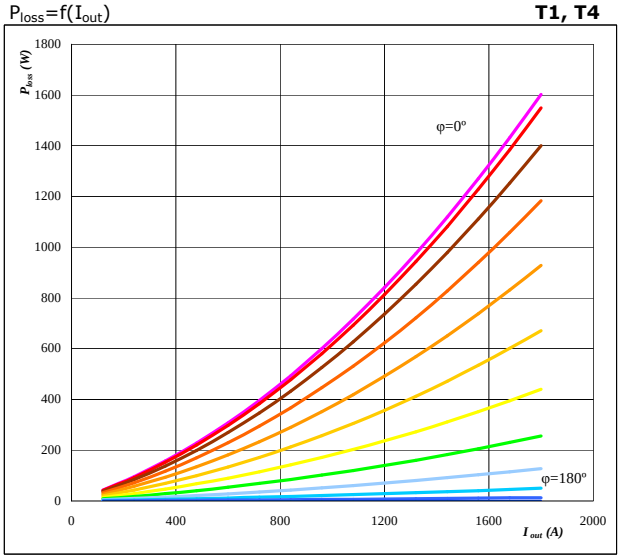

Conditions T_j= 125 °C
parameter φ from 0° to 180°
in 12 steps

Figure 2. Neutral Point FWD

Typical average static loss as a function of output current I_{oRMS}

$P_{loss}=f(I_{out})$ **D5, D6**

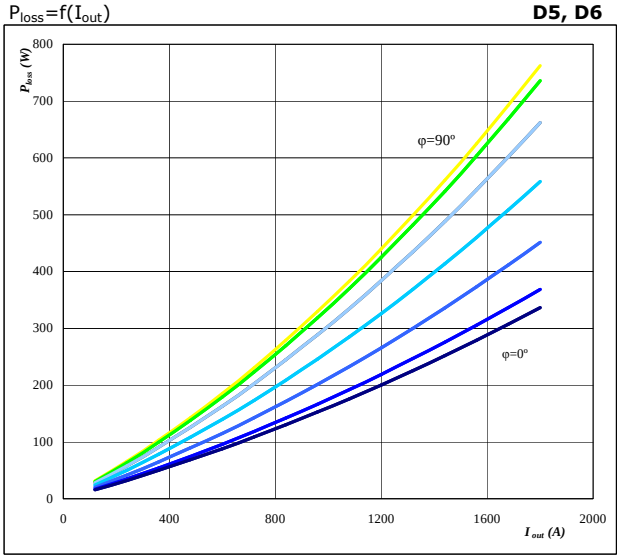

Conditions T_j= 125 °C
parameter φ from 0° to 180°
in 12 steps

Figure 3. Half Bridge IGBT

Typical average static loss as a function of phase displacement φ

$P_{loss}=f(\varphi)$ **T1, T4**

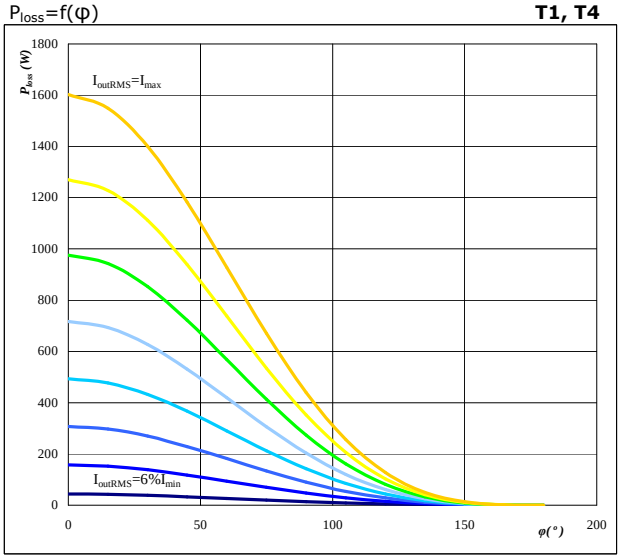

Conditions T_j= 125 °C
parameter I_{oRMS} from 120 A to 1800 A
in steps of 240 A

Figure 4. Neutral Point FWD

Typical average static loss as a function of phase displacement φ

$P_{loss}=f(\varphi)$ **D5, D6**

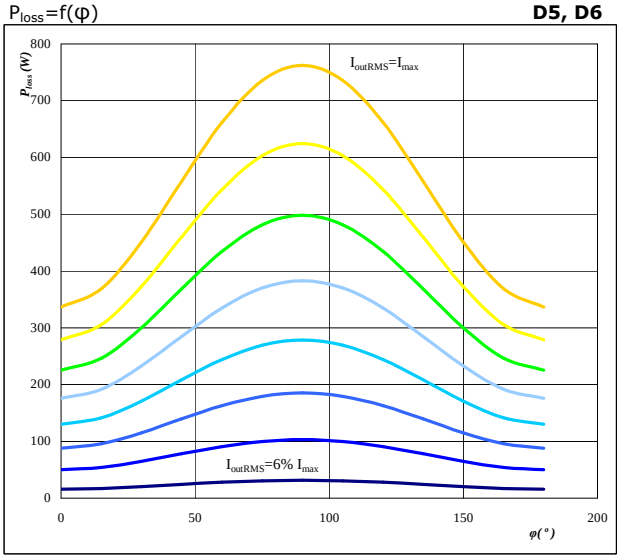

Conditions T_j= 125 °C
parameter I_{oRMS} from 120 A to 1800 A
in steps of 240 A

flow MNPC 12w — mixed voltage NPC Application — 1200 V / 1800 A

Figure 5. Half Bridge IGBT

Typical average switching loss as a function of phase displacement φ

$P_{loss}=f(\varphi)$ **T1, T4**

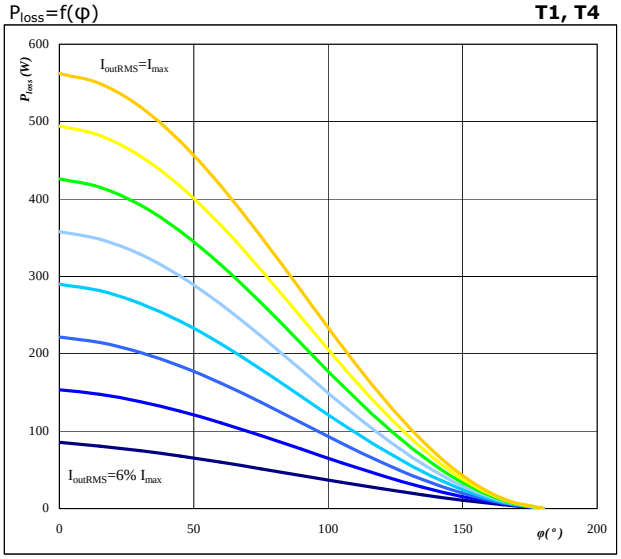

Conditions	T_j=	125	°C	
	f_{sw}=	8	kHz	
	DC link=	700	V	
parameter	I_{oRMS}	from	120 A	to 1800 A
		in steps of	240 A	

Figure 6. Neutral Point FWD

Typical average switching loss as a function of phase displacement φ

$P_{loss}=f(\varphi)$ **D5, D6**

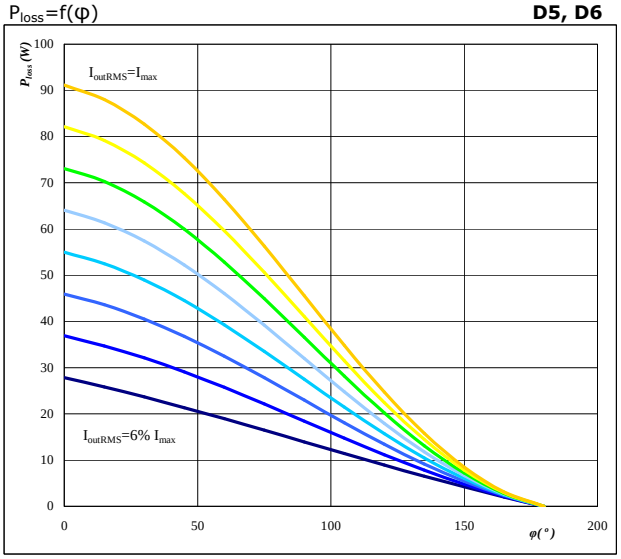

Conditions	T_j=	125	°C	
	f_{sw}=	8	kHz	
	DC link=	700	V	
parameter	I_{oRMS}	from	120 A	to 1800 A
		in steps of	240 A	

Figure 7. Half Bridge IGBT

Typical total loss as a function of phase displacement φ and output current I_{oRMS}

$P_{loss}=f(Io_{RMS};\varphi)$ **T1, T4**

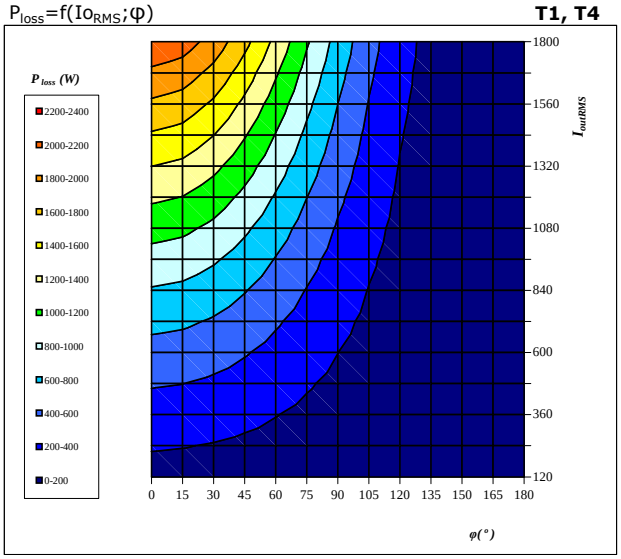

Conditions	T_j=	125	°C
	DC link=	700	V
	f_{sw}=	8	kHz

Figure 8. Neutral Point FWD

Typical total loss as a function of phase displacement φ and output current I_{oRMS}

$P_{loss}=f(Io_{RMS};\varphi)$ **D5, D6**

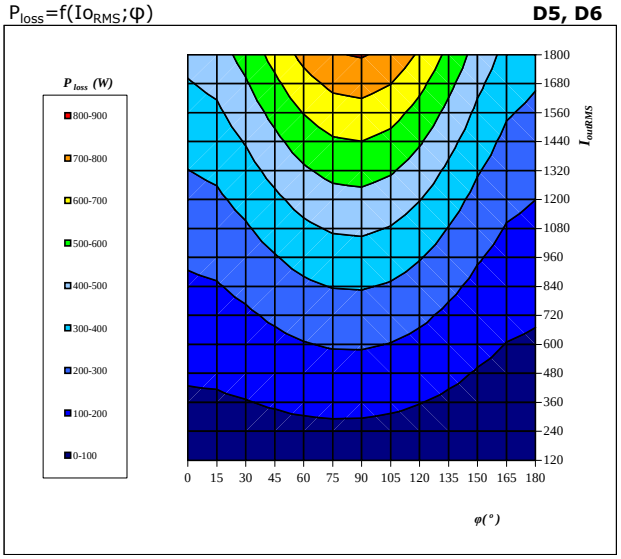

Conditions	T_j=	125	°C
	DC link=	700	V
	f_{sw}=	8	kHz

Figure 9. for Half Bridge IGBT+ Neutral Point FWD

Typical available output current as a function of phase displacement φ

$I_{out}=f(\varphi)$ **T1, T4+D5, D6**

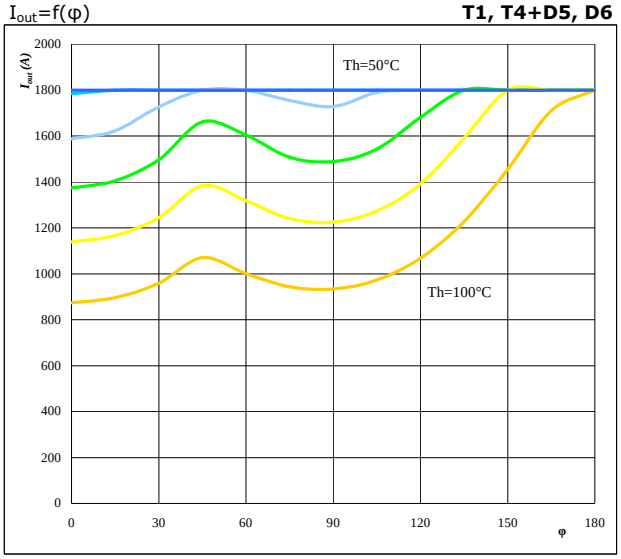

Conditions	T_j=	125	°C	f_{sw}=	8 kHz
	DC link=	700	V		
parameter:	Heatsink temp.				
	T_h from	50	°C to	100	°C
	in	10	°C	steps	

Figure 10. for Half Bridge IGBT+ Neutral Point FWD

Typical available output current as a function of switching frequency f_{sw}

$I_{out}=f(f_{sw})$ **T1, T4+D5, D6**

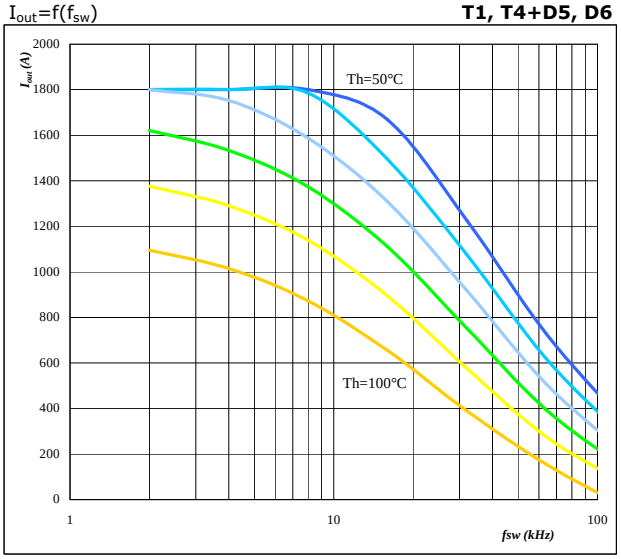

Conditions	T_j=	125	°C	φ=	0 °
	DC link=	700	V		
parameter	Heatsink temp.				
	T_h from	50	°C to	100	°C
	in	10	°C	steps	

Figure 11. for Half Bridge IGBT+ Neutral Point FWD

Typical available 50Hz output current as a function of fsw and phase displacement φ

$I_{out}=f(f_{sw},\varphi)$ **T1, T4+D5, D6**

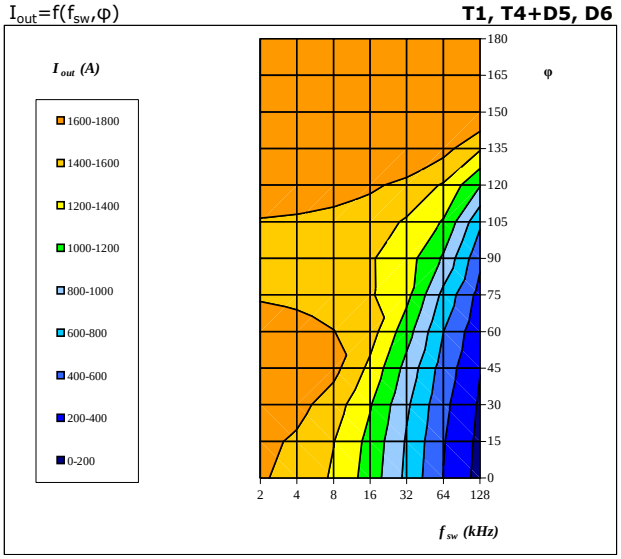

Conditions	T_j=	125	°C
	DC link=	700	V
	T_h=	80	°C

Figure 12. Neutral Point IGBT

Typical average static loss as a function of output current

P_{loss}=f(Iout) **T2, T3**

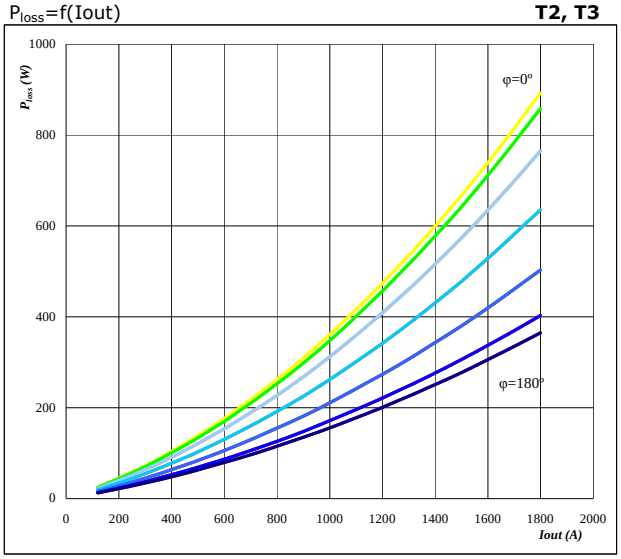

Conditions	T_j=	125	°C		
parameter	**φ**	from	0°	to	180°
		in	12	steps	

Figure 13. Half Bridge FWD

Typical average static loss as a function of output current

P_{loss}=f(Iout) **D2, D3**

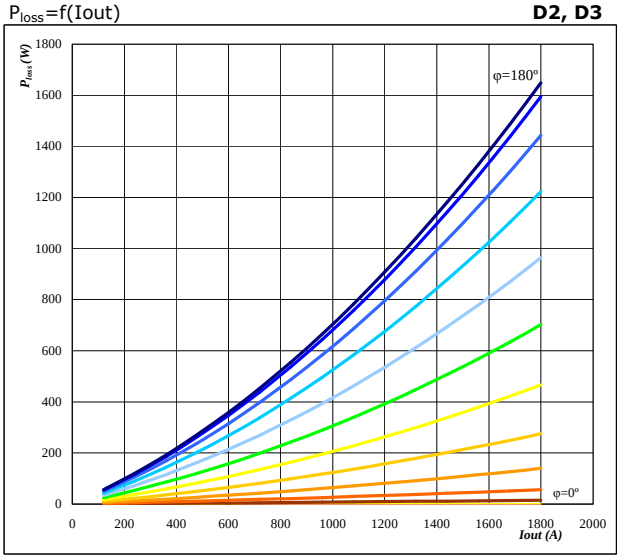

Conditions	T_j=	125	°C		
parameter	**φ**	from	0°	to	180°
		in	12	steps	

Figure 14. Neutral Point IGBT

Typical average static loss as a function of phase displacement

P_{loss}=f(φ) **T2, T3**

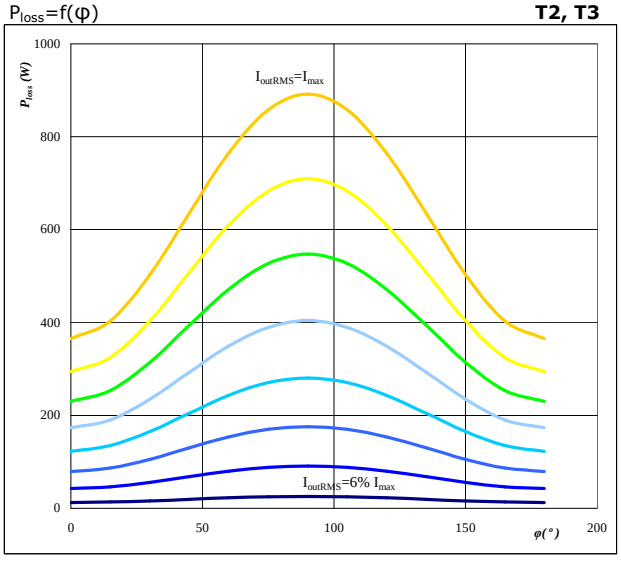

Conditions	T_j=	125	°C		
parameter	I_{oRMS}	from	120 A	to	1800 A
		in steps of	240 A		

Figure 15. Half Bridge FWD

Typical average static loss as a function of phase displacement

P_{loss}=f(φ) **D2, D3**

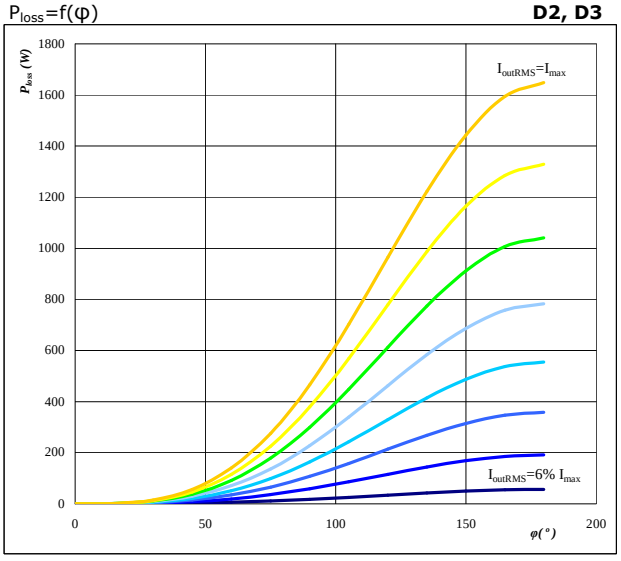

Conditions	T_j=	125	°C		
parameter	I_{oRMS}	from	120 A	to	1800 A
		in steps of	240 A		

Figure 16. Neutral Point IGBT

Typical average switching loss as a function of phase displacement

$P_{loss}=f(\varphi)$ **T2, T3**

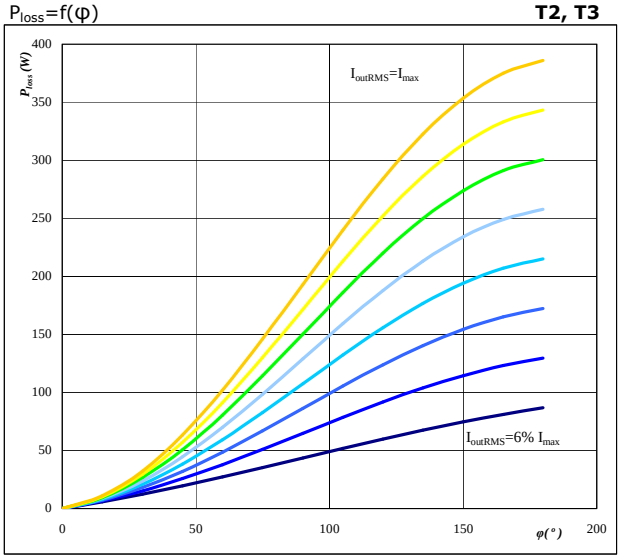

Conditions	T_j=	125	°C	f_{sw}=	8	kHz
	DC link=	700	V			
parameter	I_{oRMS}	from	120 A	to	1800	A
		in steps of	240 A	A		

Figure 17. Half Bridge FWD

Typical average switching loss as a function of phase displacement

$P_{loss}=f(\varphi)$ **D2, D3**

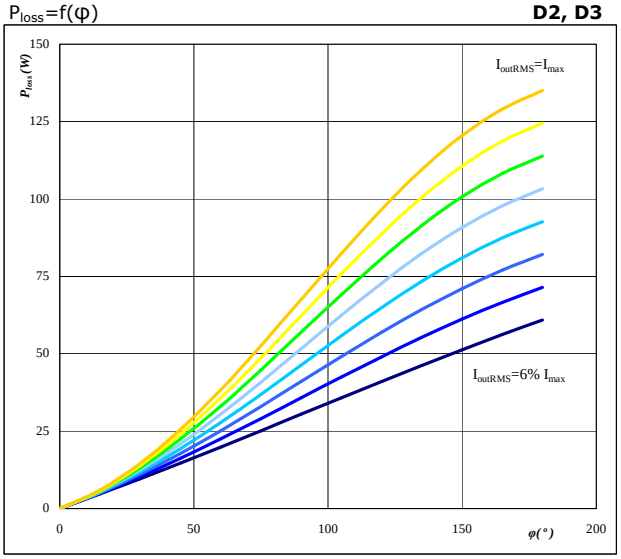

Conditions	T_j=	125	°C	f_{sw}=	8	kHz
	DC link=	700	V			
parameter	I_{oRMS}	from	120 A	to	1800	A
		in steps of	240 A	A		

Figure 18. Neutral Point IGBT

Typical total loss as a function of phase displacement and Iout$_{RMS}$

$P_{loss}=f(Io_{RMS};\varphi)$ **T2, T3**

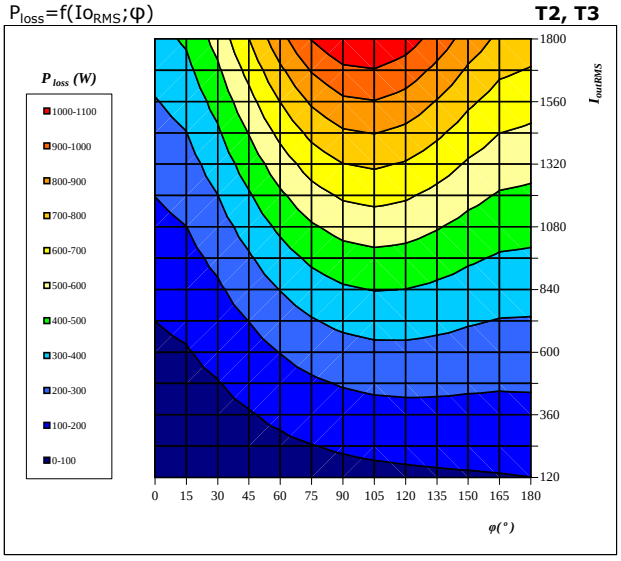

Conditions	T_j=	125	°C
	DC link=	700	V
	f_{sw}=	8	kHz

Figure 19. Half Bridge FWD

Typical total loss as a function of phase displacement and Iout$_{RMS}$

$P_{loss}=f(Io_{RMS};\varphi)$ **D2, D3**

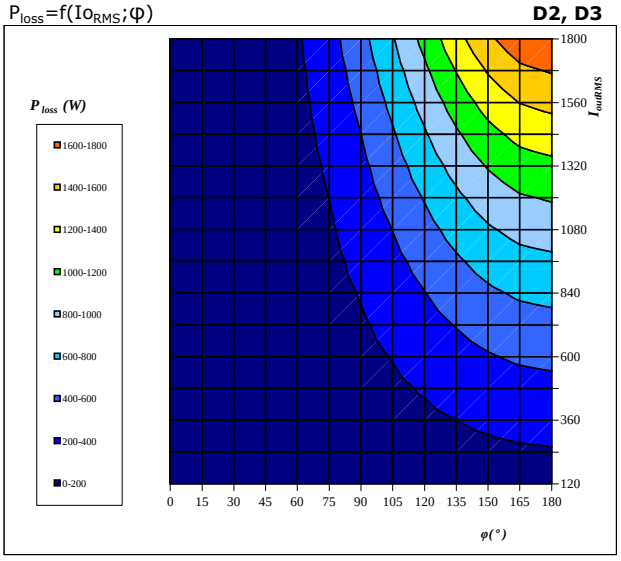

Conditions	T_j=	125	°C
	DC link=	700	V
	f_{sw}=	8	kHz

Figure 20. for Neutral Point IGBT+ Half Bridge FWD

Typical available output current as a function of of phase displacement

$I_{out}=f(\varphi)$ **T2, T3+D2, D3**

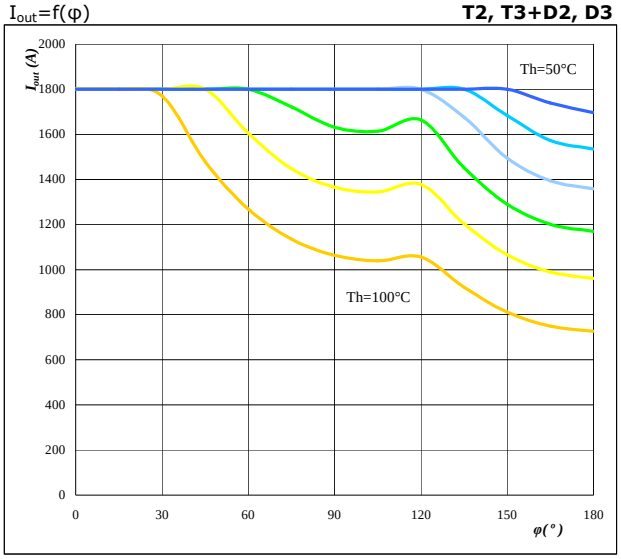

Conditions	T_j=	125	°C	f_{sw}=	8 kHz
	DC link=	700	V		
parameter:	Heatsink temp.				
	Th from	50	°C to	100	°C
	in	10	°C	steps	

Figure 21. for Neutral Point IGBT+ Half Bridge FWD

Typical available output current as a function of switching frequency

Iout=f(fsw) **T2, T3+D2, D3**

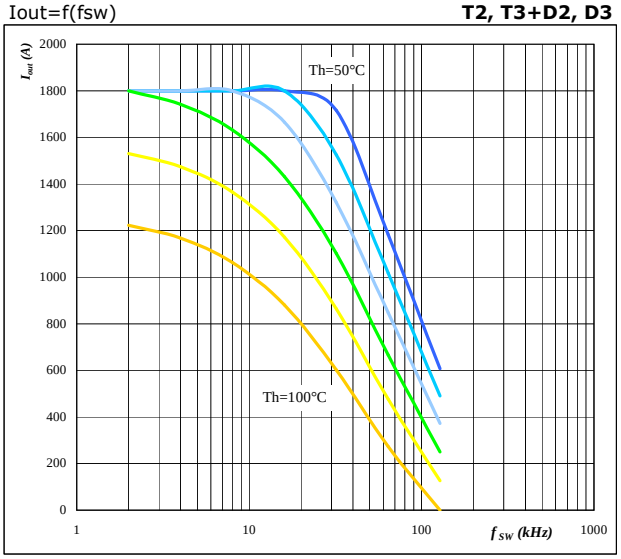

Conditions	T_j=	125	°C	φ=	90°
	DC link=	700	V		
parameter:	Heatsink temp.				
	Th from	50	°C to	100	°C
	in	10	°C	steps	

Figure 22. for Neutral Point IGBT+ Half Bridge FWD

Typical available 50Hz output current as a function of fsw and phase displacement

$I_{out}=f(f_{sw},\varphi)$ **T2, T3+D2, D3**

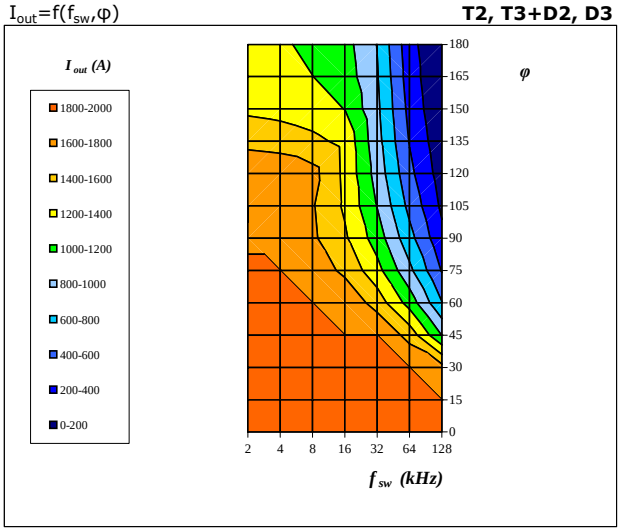

Conditions	T_j=	125	°C
	DC link=	700	V
	T_h=	80	°C

Figure 23. per PHASE

Typical available output current as a function of heat sink temperature

$I_{out}=f(T_h)$

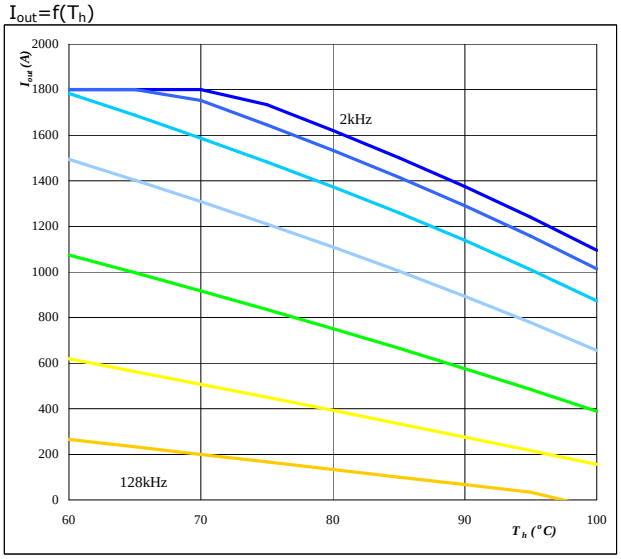

Conditions	T_j=	125	°C	
	DC link=	700	V	
	φ=	0 °		
parameter:	Switching freq.			
	fsw from	2	kHz to	128 kHz
	in steps of factor 2			

Figure 24. per PHASE

Typical available output current as a function of phase displacement

$I_{out}=f(\varphi)$

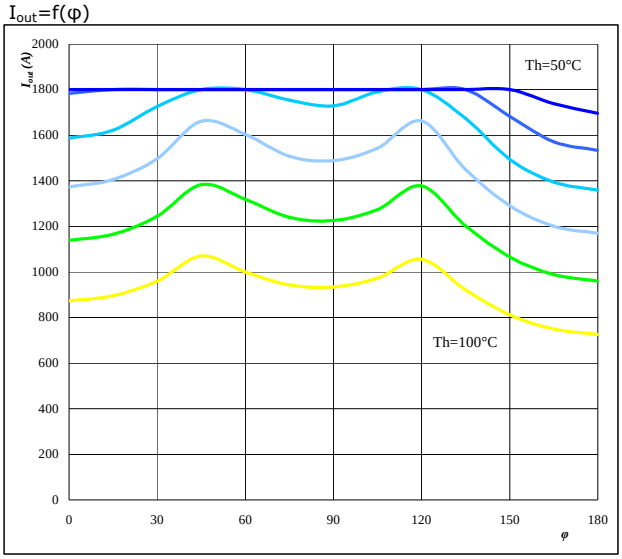

Conditions	T_j=	125	°C	
	DC link=	700	V	
	f_{sw}=	8	kHz	
parameter:	Heatsink temp.			
	Th from	50	°C to	100
	in	10	°C	steps

Figure 25. per PHASE

Typical available output current as a function of switching frequency

Iout=f(fsw)

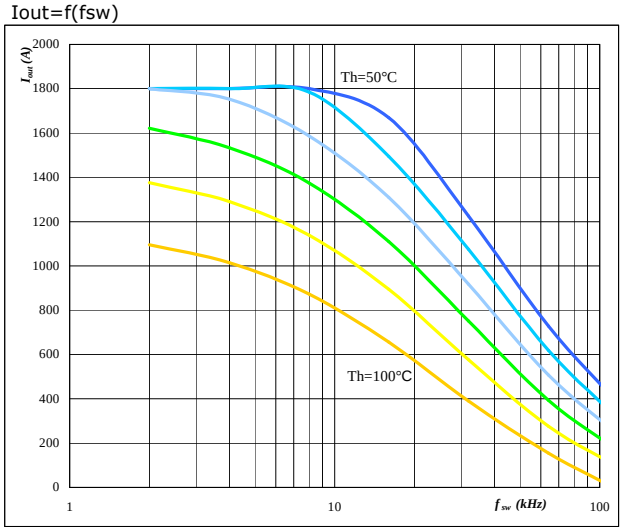

Conditions	T_j=	125	°C	φ=	0 °	
	DC link=	700	V			
parameter:	Heatsink temp.					
Th from	50	°C to	100			
in	10	°C	steps			

Figure 26. per PHASE

Typical available 50Hz output current as a function of fsw and phase displacement

$I_{out}=f(f_{sw},\varphi)$

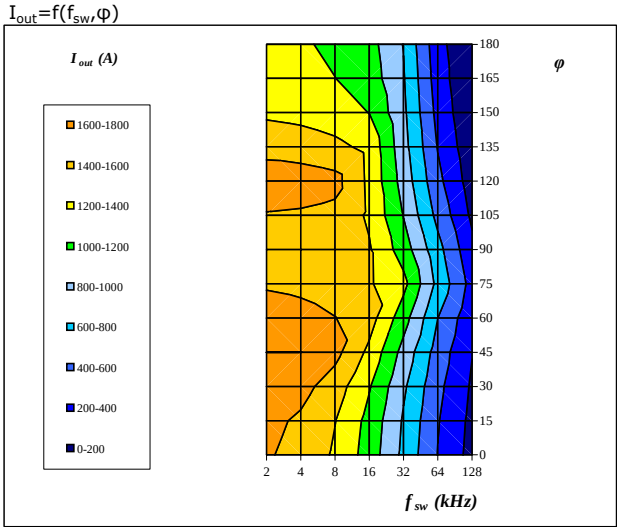

Conditions	T_j=	125	°C
	DC link=	700	V
	T_h=	80	°C

Figure 27. per PHASE

Typical efficiency as a function of output power

η=f(Pout)

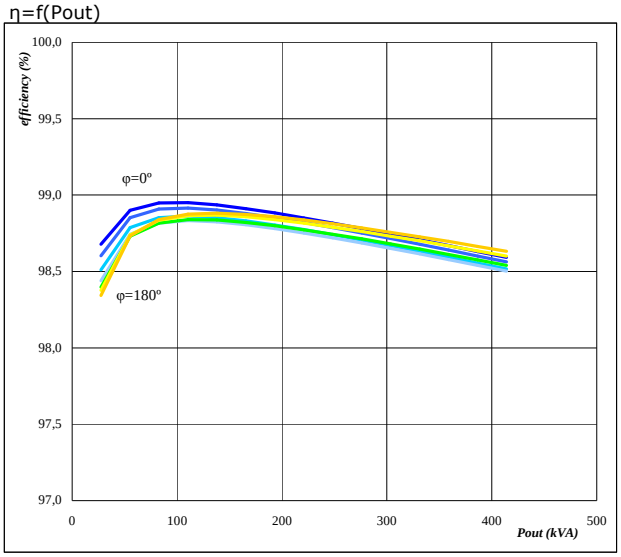

Conditions T_j= 125 °C
f_{sw}= 8 kHz
DC link= 700 V
parameter: phase displacement
φ from 0 ° to 180 °
in steps of 30 °

Figure 28. per PHASE

Typical efficiency as a function of output power

η=f(Pout)

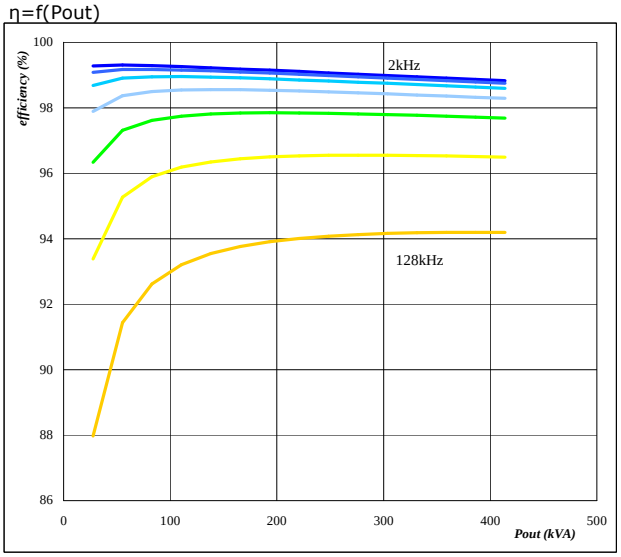

Conditions T_j= 125 °C φ= 0 °
DC link= 700 V
parameter: Switching freq.
fsw from 2 kHz to 128 kHz
in steps of factor 2

Figure 29. per PHASE

Typical available output power as a function of heat sink temperature

$P_{out}=f(T_h)$

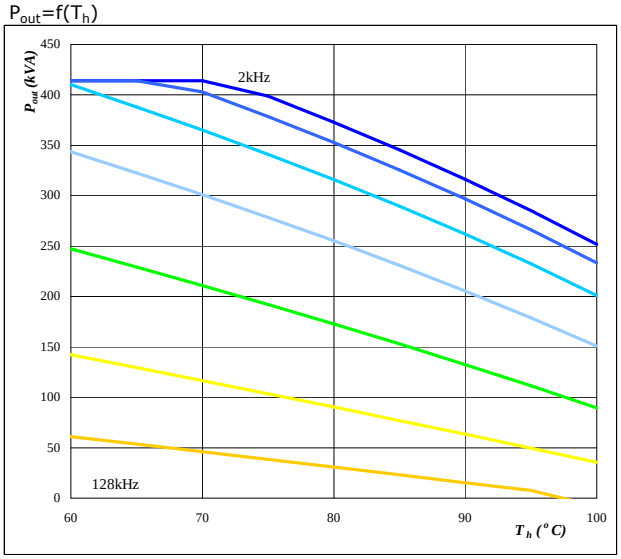

Conditions T_j= 125 °C
DC link= 700 V
φ= 0 °
parameter: Switching freq.
fsw from 2 kHz to 128 kHz
in steps of factor 2

Figure 30. per PHASE

Typical loss distribution as a function of output current

$P_{out}=f(T_h)$

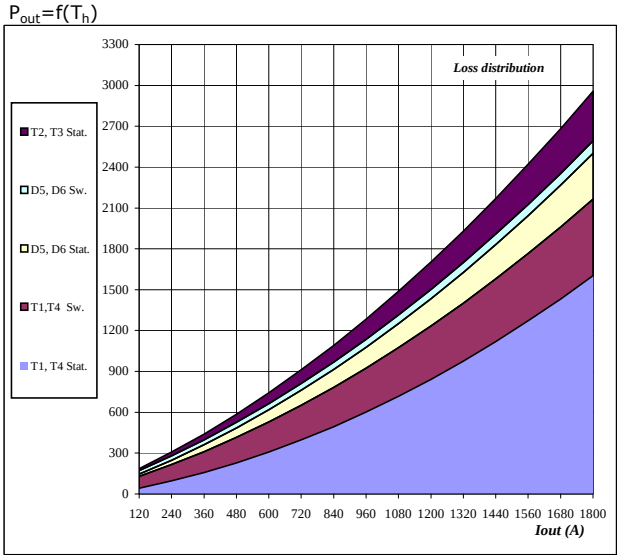

Conditions T_j= 125 °C
f_{sw}= 8 kHz
DC link= 700 V
φ= 0 °

Figure 31. per PHASE
Typical relativ loss distribution as a function of output current
$P_{out}=f(T_h)$

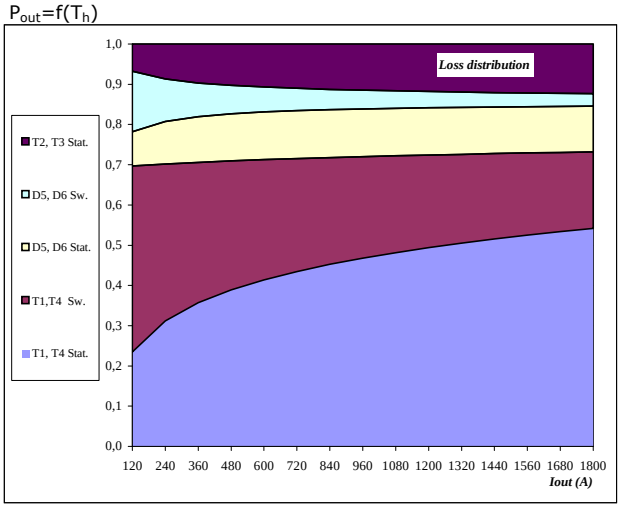

Conditions			
	T_j=	125	°C
	f_{sw}=	8	kHz
	DC link=	700	V
	φ=	0 °	